



**FIRE
TECHNOLOGY
SERVICES**

Confidential Report

Our Ref: 2702646A/10/12

Notified Body
for PPE Directive,
Construction Products Directive
& Marine Equipment Directive
I.D. No. 0338 & 0339

**Fire Technology Services
A division of BTTG T & C Ltd
Wira House, West Park Ring Road,
Leeds, LS16 6QL**



Tel No: +44 (0)113 25919969 Fax No: +44 (0)113 2780306



**FIRE
TECHNOLOGY
SERVICES**

BTTG Testing & Certification Ltd.
Wira House
West Park Ring Road
Leeds, LS16 6QL
England

Tel: +44 (0)113 259 1999
Fax: +44 (0)113 278 0306
Web: <http://www.bttg.co.uk>
Email: CSLeeds@bttg.co.uk

15 October 2012

Our Ref: 2702646A/10/12
Your Ref:

Page 1 of 4

Client: Kvadrat A/S
Lundbergsvej 10
8400 Ebeltoft
Denmark

Job Title: **Fire Test on One Sample of Fabric**

Clients Order Ref: ---

Date of Receipt: 3 October 2012

Description of Sample: One sample of fabric, referenced: **Savanna, 31% New Wool, 26% Acrylic, 3% Polyamide, 2% Linen.**

Work Requested: Fire Technology Services were requested to carry out a fire test on the sample supplied to BS 5852 Part 1, Sources 0 & 1.





15 October 2012

Page 2 of 4

Our Ref: 2702646A/10/12
Your Ref:

Kvadrat A/S

**STATUTORY INSTRUMENT NO.1324 CONSUMER PROTECTION
THE FURNITURE AND FURNISHINGS (FIRE) (SAFETY) REGULATIONS 1988
(SI No 2358 Amendment 1989)**

Date of Test: 15/10/2012

Conditioning

Immediately prior to testing the sample was placed in indoor ambient conditions for 72 hours and then conditioned in a standard atmosphere of 20 ±5°C temperature and 50 ± 20% relative humidity for at least 16 hours. The sponsor sampled the material and the specimens were cut from the sample received to the dimensions set out in the standard by FTS.

The sample was tested in a room of volume 25m³ and 21°C.

Procedure

The sample was tested in accordance with Schedule 4 Part I and Schedule 5 Part I of the above regulations.

The specimens were mounted over fillings of standard non-FR polyurethane foam of density about 22Kg/m³.

Tests were made in accordance with BS 5852 part 1 using ignition source 0 and 1

Requirements

Ignition Source 0	No progressive smouldering or flaming within one hour of the placement of the cigarette.
Ignition Source 1	All progressive smouldering and flaming to cease within 120s of removal of the burner tube.

In relation to progressive smouldering for ignition source 1, it has been clarified by the British Standards Institution Committee responsible for the development of BS 5852: Part 1:1979 (CCM/44) that it is necessary to observe test specimens for a period of 15 minutes from the removal of the gas flame in order to determine whether or not the specimen is smouldering progressively.





**FIRE
TECHNOLOGY
SERVICES**

BTTG Testing & Certification Ltd.
Wira House
West Park Ring Road
Leeds, LS16 6QL
England

Tel: +44 (0)113 259 1999
Fax: +44 (0)113 278 0306
Web: <http://www.bttg.co.uk>
Email: CSLeeds@bttg.co.uk

15 October 2012

Page 3 of 4

Our Ref: 2702646A/10/12
Your Ref:

Kvadrat A/S

Results

The following test results relate only to the ignitability of the combination of materials under the particular conditions of test; they are not intended as a means of assessing the full potential fire hazard of the materials in use.

During testing the following was noted:-

	Source 0		Source 1
	Time of ignition(s)	---	---
Time of Flame Extinction(s)	---	---	>90
Time of Smoke Extinction(s)	1646	1661	---
Time of cover split(s)	DNS	DNS	13
Melting (Yes or No)	No	No	No
Dripping (Yes or No)	No	No	No
Charring (Yes or No)	Yes	Yes	Yes
Other Phenomena			ME, BTTF, EC
Pass / Fail	Pass	Pass	Fail

DNS Material did not split
ME Manually extinguished
BTTF Burnt through thickness of foam
EC Escalating combustion





**FIRE
TECHNOLOGY
SERVICES**

BTTG Testing & Certification Ltd.
Wira House
West Park Ring Road
Leeds, LS16 6QL
England

Tel: +44 (0)113 259 1999
Fax: +44 (0)113 278 0306
Web: <http://www.bttg.co.uk>
Email: CSLeeds@bttg.co.uk

15 October 2012

Page 4 of 4

Our Ref: 2702646A/10/12
Your Ref:

Kvadrat A/S

Comments

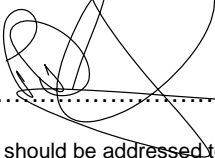
The specimens were tested after a water soaking procedure specified in BS 5651:1978, except for:

After 30 minutes, the specimen was removed, rinsed in water using a liquor ratio of 1:20 for 2 minutes, and then dried by hanging the fabric until it has dripped dry and then placing back into conditioning as stated above.

The specimens were tested as received. The results indicate that the above sample did not meet the performance requirements.

An estimation of uncertainty of measurement has not been taken into account when making a judgement to any pass/fail criteria.

Reported by:.....  B Marsden (Mrs), Fire Technician

Countersigned by:.....  P Doherty, Operational Head

Enquiries concerning this report should be addressed to Customer Services.

